
UD32-16-8-SS

Ruland UD32-16-8-SS, 1" x 1/2" Double Universal Joint, Friction Bearing, Stainless Steel, 1.995" OD, 8.688" Length



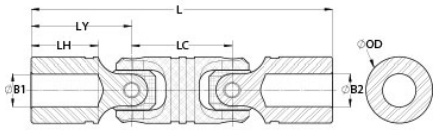

Description

Ruland UD32-16-8-SS is a double cardan friction bearing universal joint with 1.0000" x 0.5000" bores, 1.995" OD, and 8.688" length. It is ideal for applications with wide distances between shafts and can accommodate all forms of misalignment. This plain bearing double universal joint is comprised of pins and blocks that are precision machined, selectively heat treated, and ground for high strength, accuracy, and wear resistance. The combination of these components with precision ground and hardened yoke ears allow for a longer lifespan, increased performance in demanding applications, and greater angular misalignment of up to 90° when compared to commodity style double universal joints. UD32-16-8-SS is made from high grade stainless steel for increased corrosion resistance. It can be combined with boot UBOOT32/51-NI-KIT to protect the joints from unwanted contaminants such as dust or water and self lubricate reducing maintenance time. This double cardan universal joint is manufactured in the USA by Belden Universal for strict control of processes.

Product Specifications

Bore (B1)	1.0000 in	**Small Bore (B2)**	0.5000 in
B1 Max Shaft Penetration	1.700 in	**B2 Max Shaft Penetration**	1.700 in
Joint Outer Diameter (OD)	1.995 in	**Bore Tolerance**	+0.0010 in / -0.0000 in
Length (L)	8.688 in	**Center Yoke Length (LC)**	3.188 in
Yoke Length (LY)	2.750 in	**Hub Depth (LH)**	1.700 in
Peak Torque	14040 in-lb	**Rated Torque**	2,808 in-lb
Max Operating Angle	90°	**Material Specification**	Yokes: 303 Stainless Steel Pins and Blocks: 416 Stainless Steel
Manufacturer	Belden Universal	**Country of Origin**	USA
Recommended Lubricant	LUBRIPLATE No. 1200-2	**Matching Boot Cover**	UBOOT32/51-NI-KIT
UPC	63452932030	**Tariff Code**	8483.60.4000
UNSPC	25173810		
Note 1	Performance ratings are for guidance only. The user must determine suitability for a particular application.		
Prop 65	⚠**WARNING** This product can expose you to the chemical Nickel (metallic), known to the State of California to cause cancer. For more information go to www.P65Warnings.ca.gov.		